



FC Quick Connector Manual


- 1、 Put the optic cable into the connector boot, and take off the jacket leaving 55mm fiber.

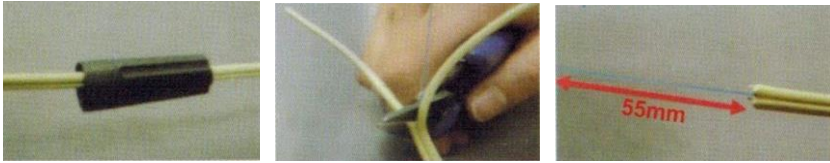

- 2、 Locate the cable by the guide which is provided with the fast connector, keep the fiber without jacket in 24mm, and then peel off the coating.

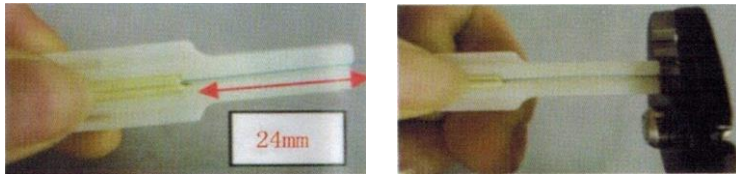

- 3、 Clean the fiber, and cut it at the 10mm length by fiber cleaver.

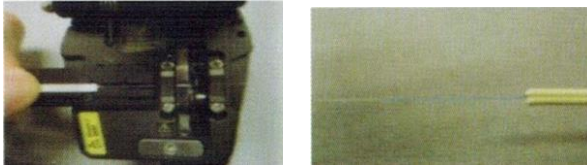

(*) 0.125mm:10mm,0.250mm:24mm

- 4、 Connect the fiber.

5、

Fiber groove



Check hole




- Insert the fiber into the body till it touches the end, and make it bend slightly.

- 5、 Fix the fiber




- Press the connector cap by the thumb, and meantime hold the connector boot tightly to prevent the fiber moving.

- 6、 Take off the T tool

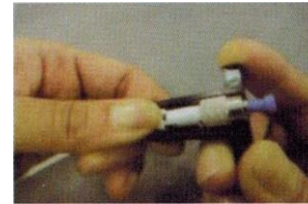


- Remove the T tool after fixing the fiber. Check and adjust the bending part. It can't be too tight or too loose.

- 7、 Screw the connector boot and fix the connector.

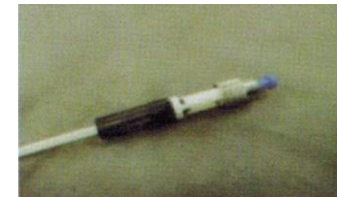

- 8、 Install the cover in the place with red circle.

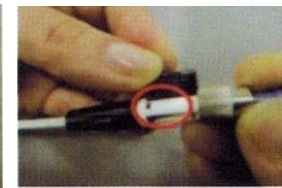

- 9、 Disassemble

Take off the cover - screw off the but- install T tool- take out the cable.